


# S20T

S20TR2-SLRA8-35

一体型 3°

刚性值 (μm / kgf)  
P.218

平衡值 (N)  
P.221

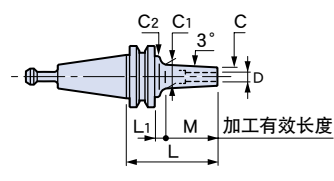

■ 注意事项  
● 刀具安装... 插入刀具时, 请务必将刀具插入比安全记号更深的位置。

SUGINO  
V9/NSV9/H5/H7/H9

HEATROBO 电磁 1200S (HRD-01S-230AS)  
电磁式加热器对应表  
[O] 可加热 [X] 不可加热

コード	φD	φC	t	L	M	L1	φC1	φC2	H	h	Kg	N	S	缩略图
S20TR2-SLSA 3-40 -60	3	6	1.5	40	22	5.5	8.3	20	9	46	0.1	0.4	4.6	○
				60	42					66				
S20TR2-SLSA3.175-40 -60	3.175	6.175	1.5	40	22	5.5	8.5	20	9	46	0.1	0.4	4.4	○
				60	42					66				
S20TR2-SLSA 4-40 -60	4	7	1.5	40	22	5.5	9.3	20	12	46	0.1	0.4	3.6	○
				60	42					66				
S20TR2-SLSA 5-40 -60	5	8	1.5	40	22	5.5	10.3	20	15	46	0.1	0.4	2.8	○
				60	42					66				
S20TR2-SLSA 6-60 -SLRA 6-35	6	9	1.5	60	42	5.5	13.4	20	18	66	0.1	0.5	4.7	○
		12	3	35	19.6					2.9				
S20TR2-SLRA 8-35	8	14	3	35	19.6	2.9	16.1	—	20	51	0.1	0.4	0.9	×
S20TR2-SLRA10-35	10	16	3	35	19.6	2.9	18.1	—	20	51	0.1	0.5	0.8	×
S20TR2-SLRA12-45	12	20	4	45	32.5	—	23.4	—	30	51	0.2	0.6	0.8	×

S=1:4

φ3

S20TR2-SLSA3-40  
No.1  
t=1.5  
4.6

S20TR2-SLSA3-60  
No.2  
t=1.5  
9.2

φ3.175

S20TR2-SLSA3.175-40  
No.3  
t=1.5  
4.4

S20TR2-SLSA3.175-60  
No.4  
t=1.5  
8.8

φ4

S20TR2-SLSA4-40  
No.5  
t=1.5  
3.6

S20TR2-SLSA4-60  
No.6  
t=1.5  
7.2

φ5

S20TR2-SLSA5-40  
No.7  
t=1.5  
2.8

S20TR2-SLSA5-60  
No.8  
t=1.5  
5.8

φ6

S20TR2-SLSA6-60  
No.9  
t=1.5  
4.7

S20TR2-SLRA6-35  
No.10  
t=3  
1.1

φ8

S20TR2-SLRA8-35  
No.11  
t=3  
0.9

φ10

S20TR2-SLRA10-35  
No.12  
t=3  
0.8

φ12

S20TR2-SLRA12-45  
No.13  
t=4  
0.8